

No. 10-03-02-14R/01

ASS FME CIL DAT SUF DAT CIL APF	ASSEMBLY: Safe FMEA ITEM NO.: 10-0 CIL REV NO.: N (D DATE: 05 C SUPERSEDES PAGE: 420- DATED: 31 J			31 Jul 2000 D. J. McGough EERING: <u>K. G. Sanofsky</u>		ATEGORY: 1R Redesigned Barrier-I Assembly, Lower Ro Seals & Leak Check (See Section 6.0) Boost (BT) (See Section 6.0) (See Table 101-6) BI-02	tor Shaft
				N. O. Opeas	05 Oct 2001		
1.0	FAILUR	E CONDITION	N:	Failure during operation (D)			
2.0	FAILUR	E MODE:		1.0 Leakage of the lower rotor si	haft seals and lea	k check port seal	
3.0	FAILUR	E EFFECTS:		Would allow hot gas flow along to burn-through causing loss of the			resulting in a
4.0	FAILUR	E CAUSES (F	FC):				
	FC NO.	DESCRIPTION	ON			FAILURE	CAUSE KEY
	1.1	Nonconformi	ing o	dimensions			Α
	1.2	Nonconformi	ing r	nonmetallic material properties			В
	1.3	Performance	e de	gradation due to aging			С
	1.4	Damage to C	O-rin	gs, threads, or sealing surfaces			D
	1.5	Nonconformi	ing s	surface or subsurface defects in	O-rings		Е
	1.6	Nonconformi	ing f	inish of sealing surfaces or conta	amination on seal	ing surfaces	F
	1.7	Improper ins	stalla	ition of components			G
	1.8	Cracks, corre	Cracks, corrosion, or other material defects				Н



05 Oct 2001 DATF: SUPERSEDES PAGE: 420-1ff. No. 10-03-02-14R/01

DATED: 31 Jul 2000

5.0 REDUNDANCY SCREENS:

SCREEN A: Fail--The leak check port seal cannot be verified during mission turnaround.

SCREEN B: Fail--No provision is made for failure detection by the crew.

SCREEN C: Pass--The lower rotor shaft seals and leak check port plug seals cannot be lost by a single

credible cause.

The lower rotor shaft O-rings and the leak check port O-ring, together, form a redundant seal system for a potential leak path through the Barrier-Booster Assembly. The leak check port O-ring will not be pressurized unless the lower rotor shaft O-ring seals fail. If both the lower rotor shaft O-ring seals and the leak check port O-ring seals fail, a leak path would exist which could result in loss of crew and vehicle.

6.0 ITEM DESCRIPTION:

The Barrier-Booster Assembly of the Safety and Arming (S&A) device consists of a stainless steel housing with a rotating barrier mechanism centered within it. Two SRM ignition initiators (SIIs) are screwed into opposite sides of the base section. Midway up the housing is a leak check port that enables the leak checking of the rotor shaft seals (Figure 1, 2, and 3). The assembly is shown on engineering drawings. Drilled passages and leak check ports are shown on engineering drawings. The Barrier-Booster Assembly is obtained by Thiokol as a complete assembly. Materials are listed in Table 1.

562 2. The leak check port plug is also known as the RSRM Port Plug (closure screw for lock/safety wire).

TABLE 1. MATERIALS

Drawing No.	Name	Material	Specification	Quantity
1U50228	Packing, Preformed	Fluorocarbon Rubber	STW4-3339	2/Motor
1U50688	Rotor, Output Barrier	A286 CRES	AMS 5737	1/Motor
1U51916	Cartridge Assembly-Sealant/Adhesive	Lubricant, Extra Refined	STW7-3657	A/R
1U77383	Housing, Barrier-Booster	A286 CRES	AMS 5737	1/Motor
1U77385	Barrier-Booster Assembly S&A Device			1/Motor
1U77386	Barrier-Booster Assembly, S&A Device,			1/Motor
41.170070	Loaded	00000	4440 5040	0/14 /
1U78676	RSRM Port Plug	CRES Steel	AMS 5646	3/Motor
	(closure screw for lock/safety wire)			
MS28774-010	Retainer, Rotor	Tetra Fluoroethylene		2/Motor
MS20995C20	Locking Wire, Safety	CRES 302 or 304	QQ-W-423	A/R
	Lubricant	Krytox(240 AZ)	MIL-G-27617,	
		Fluorinated Grease	Type I	A/R
	Lubricant	Heavy-Duty Calcium Grease	STW5-2942	A/R

6.1 CHARACTERISTICS:

- The RSRM Safety and Arming (S&A) device meets established requirements for performance, design, development, test, manufacture, and acceptance for a two-part electromechanical safety and arming device per engineering.
- O-rings are used to seal the lower rotor shaft position and the leak check port plug (Figures 2 and 3).
- After each use, the Barrier-Booster is completely disassembled and refurbished by the supplier using new seals.

7.0 FAILURE HISTORY/RELATED EXPERIENCE:

Current data on test failures, flight failures, unexplained failures, and other failures during RSRM ground processing activity can be found in the PRACA Database.



DATE: 05 Oct 2001 No. 10-03-02-14R/01 SUPERSEDES PAGE: 420-1ff.

31 Jul 2000 DATED:

8.0 OPERATIONAL USE: N/A

REVISION N (DCN-562R1)

TWR-15712 DOC NO. SEC 420

PAGE 3

VOL IV



No. 10-03-02-14R/01

DATE: 05 Oct 2001 SUPERSEDES PAGE: 420-1ff. DATED: 31 Jul 2000

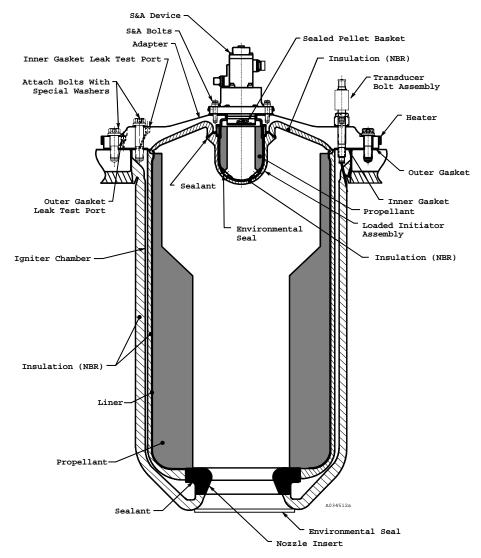


Figure 1. RSRM Ignition System

PAGE



No. 10-03-02-14R/01

DATE: 05 Oct 2001 SUPERSEDES PAGE: 420-1ff. DATED: 31 Jul 2000

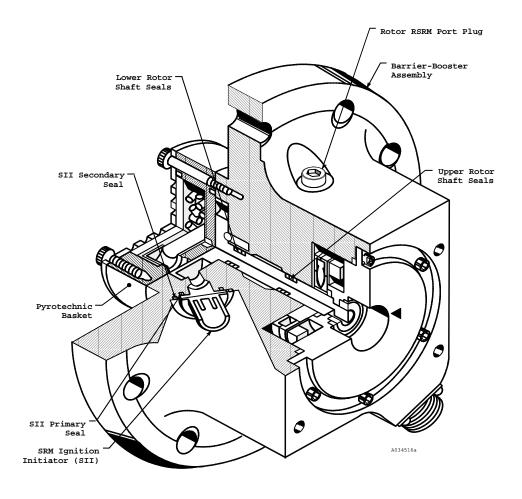


Figure 2. Barrier-Booster Assembly Leak Paths



No. 10-03-02-14R/01

05 Oct 2001 DATE: SUPERSEDES PAGE: 420-1ff. DATED: 31 Jul 2000

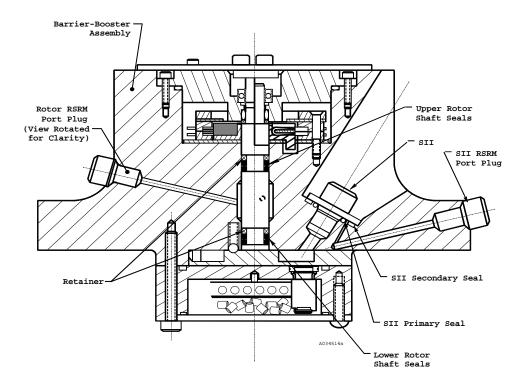


Figure 3. Barrier-Booster Assembly Leak Paths (Section View)

DOC NO. SEC



DATE: 05 Oct 2001 No. 10-03-02-14R/01 SUPERSEDES PAGE: 420-1ff. DATED: 31 Jul 2000

RATIONALE FOR RETENTION: 9.0

9.1	DESIGN:		
DCN	FAILURE CAUSES		
	Α	1.	Barrier-Booster housing dimensions are controlled per engineering drawings.
			a. Acceptance criteria for Barrier-Booster housing dimensions at refurbishment are per engineering.
	Α	2.	Rotor dimensions are controlled per engineering drawings.
562	A,B,D,F	3.	RSRM Port Plug (closure screw for lock/safety wire) design requirements are per engineering drawings and specifications.
	Α	4.	Dimensions for the retainer are controlled per engineering drawings.
	Α	5.	Small O-rings conform to engineering that establishes geometric dimensions and fabrication details.
	A,B	6.	Analysis of minimum acceptable O-ring squeeze for the Barrier-Booster Assembly, lower rotor shaft seals, and the leak check port seal is per TWR-18354.
	В	7.	Small O-rings are high-temperature, low-compression set, fluid-resistant, black fluorocarbon rubber.
	В	8.	Material requirements for grease used to lubricate the O-rings are controlled per engineering drawings.
	С	9.	Small O-rings are packaged and stored to preclude deterioration from ozone, grease, ultraviolet light, and excessive temperature.
	С	10.	Small O-ring time duration of supplier storage and total shelf life prior to installation is per engineering.
	С	11.	Aging studies of O-rings after 5 years installation life were performed. Test results are also applicable to all RSRM fluorocarbon seals. Fluorocarbon maintained its tracking ability and resiliency. Fluorocarbon was certified to maintain its sealing capability over 5 years per TWR-65546.
	С	12.	Grease is stored at warehouse-ambient condition that is any condition of temperature and relative humidity experienced by the material when stored in an enclosed warehouse, in unopened containers, or containers that were resealed after each use. Storage life under these conditions is per engineering.
	С	13.	Aging studies to demonstrate characteristics of grease after 5 years installation life were performed on TEM-9. Results showed that grease provided adequate corrosion protection for D6AC steel, and that all chemical properties of grease remained intact per TWR-61408 and TWR-64397.
	С	14.	The O-rings are one-time-use items.
	D,F	15.	Small O-rings are individually packaged in an opaque, waterproof, grease proof, and heat-sealed bag per engineering.

562 D,F

16. Rotor O-rings are lubricated with Krytox grease at installation. The RSRM Port Plug (closure screw for lock/safety wire) O-ring is lubricated by Thiokol, using



				CRITICAL ITEMS LIST (CIL)		
				No. 10-03-02-14R/01	DATE: SUPERSEDES PAGE: DATED:	05 Oct 2001 420-1ff. 31 Jul 2000
				filtered, grease prior to installation.		
	562	D,F	17.	Barrier-Booster Housing O-ring sealing surface finis leak check port is per engineering drawings. Surfa and RSRM Port Plug (closure screw for lock/safe drawings.	ce finish for the roto	or shaft
		D,F	18.	Sealing surface finish and threads for the refurbish per engineering.	ned Barrier-Booster	Housing are
		D,F	19.	Cleanliness of the Barrier-Booster Housing is control	olled per engineering	g drawings.
D,F 20. Cleanliness of the rotor is controlled per engineering drawings.						
	D,F 21. The unloaded Barrier-Booster is shipped with protective plugs installed in the ports, and protective covers top and bottom per engineering drawings.					ed in the SII
D,F 22. Contamination control requirements and procedures are per TWR-16564.					64.	
		Е	 Small O-ring surface quality conforms to engineering that establishes desi requirements and fabrication details. 			shes design
		E	24.	Testing and analysis of elastomers that estat abrasions, grind marks, scratches, cuts, inho substandard material, surface voids and inclusions are documented in TWR-17991.	mogeneities, splic	es, repairs,
		G	25.	Component installation is per engineering drawings	and shop planning.	
		Н	26.	The Barrier-Booster Housing and Rotor are made o	f A286 CRES.	
	562	Н	27.	Filtered grease is applied to the sealing surface of screw for lock/safety wire) prior to installation per en		
		Н	28.	The following parts are made from steels that excorrosion cracking per MSFC specifications.	khibit high resistand	e to stress-
ĺ	562			a. Barrier-Booster Housingb. RSRM Port Plug (closure screw for lock/safety	v wire)	
		Н	29.	Macrostructure of the Barrier-Booster Housing armust be dense, sound, uniform and free from pipes inclusions, segregations, or pin holes per engineering	, fissures, gas caviti	
		Н	30.	Forging grain flow of the Barrier-Booster Housing essentially parallel to major stressed surface areas	g and rotor are red of the part per engir	quired to be neering.
		Н	31.	Screw threads on the Barrier-Booster Assembly a reduce thread stresses that could lead to cracking of		root type to
		Н	32.	The Barrier-Booster Housing is refurbished per eng	ineering.	
	562	A,D,G	33.	Port plug vibration testing, documented in TWR-7 small amount of torque from any combination of sufficient to prevent loss of port plugs during flight S&A are lock/safety wired in place using the double	O-ring load or threat. In addition, port p	ad friction is plugs on the
l	562R	R1 A, B	34.	RSRM Port Plug lock/safety wire material conforms	to engineering requ	irements.

DOC NO. TWR-15712 VOL IV
SEC 420 PAGE 8



	DATE:	05 Oct 2001
No. 10-03-02-14R/01	SUPERSEDES PAGE:	420-1ff.
	DATED:	31 Jul 2000

9.2 TEST AND INSPECTION:

FAILURE	CAUSES	AND
---------	---------------	-----

<u>DC</u>	FAILURI N TESTS	E CAU (T)	SES AI	ND	<u>CIL CODE</u>
562			1. I	For New RSRM Port Plug (closure screw for lock/sat	fety wire) verify:
	A A A B,H D,F D,F D,F	(T)	 	a. O-ring groove diameter dimension b. Correct thread form c. Plug length d. O-ring groove width dimension e. Material is corrosion- and heat-resistant steel f. O-ring groove sealing surface blemishes g. Thread surface blemishes h. O-ring groove surface finish	AAO025 AAO071 AAO063 AAO047 AAO067 LAA270 LAA271 AAO037
			2. I	For New Small O-ring verify:	
	A A,D,F B B B C D,F D,E,F	(T) (T) (T) (T)) () () () () () () () ()	a. Inside diameter "A" b. Cross-sectional dimension "W" c. Flash dimensions d. Shore A hardness e. Tensile strength f. Ultimate elongation g. Compression-set h. Tear strength lindividually packaged and sealed in opaque baengineering surface quality k. No shipping or handling damage	AAQ002,AAQ003 AAQ004,AAQ062 AAQ111,AAQ112 LAA001,LAA006,LAA011,LAA016 LAA002,LAA007,LAA012,LAA017 LAA003,LAA008,LAA013,LAA018 LAA004,LAA009,LAA014,LAA019 LAA005,LAA010,LAA015,LAA020 ags; material is per
			3. I	For New Barrier-Booster Housing, verify:	
	A A A		Ì	a. Rotor bore diameterb. Rotor bore run outc. Rotor bore surface finish	ACY104 ACY106 ACY108



	DATE:	05 Oct 2001
No. 10-03-02-14R/01	SUPERSEDES PAGE:	420-1ff.
	DATED:	31 Jul 2000

4. For New Barrier-Booster Assembly, verify:

A,D,E, F,G,H	(T)		a.	High-pressure leak tests on unloaded Barrier-Booster Assembly	
A,D,E,				rotor shaft O-rings, rotor in "ARM" position	ACZ090
F,G,H	(T)		b.	High-pressure leak tests on unloaded Barrier-Booster Assembly	4.07000
Α			C.	rotor shaft O-rings, rotor in "SAFE" position Barrier-Booster Housing VIP complete and acceptable	ACZ092 ACZ033
A,D,F			d.	Certificate of Conformance	ACZ055
B,C			e.	Krytox grease free of contamination	DAA023
B,C			f.	Application of krytox grease to rotor shaft O-rings	ADA000
G			g.	Rotor shaft O-rings are proper type prior to installation	DAA029
G G			h. i	Rotor shaft O-rings clean and free from surface damage Proper assembly per drawings and specifications	DAA030 ACZ150
Н			i. j.	Barrier-Booster Housing for absence of corrosion prior to assembly	ACZ130 ACZ032
H			ا. k.	Barrier-Booster Rotor Assembly for absence of corrosion prior to	A02002
			•••	assembly	ACZ031
		5.	For	Refurbished Barrier-Booster Assembly, verify:	
Α			a.	Port thread configuration	ACZ133A
A			b.	Rotor bore diameter	ACZ161A
A,D,E, F,G,H	(T)		C.	High-pressure leak tests on unloaded Barrier-Booster Assembly	
. , , ,	(.,		0.	rotor shaft O-rings, rotor in "ARM" position	ACZ090A
A,D,E,	/T \		٨	High proceurs look toots on unloaded Parrier Pagetor Assembly	
F,G,H	(T)		d.	High-pressure leak tests on unloaded Barrier-Booster Assembly rotor shaft O-rings, rotor in "SAFE" position	ACZ092A
Α			e.	Barrier-Booster Housing VIP complete and acceptable	ACZ033A
Α			f.	Certificate of Conformance	ACZ054A
D,F			g.	Housing bore surface finish	ACZ098A
D,F			h.	Surface finish of O-ring groove	ACZ073A
G G			i.	Rotor shaft O-rings are proper type prior to installation	DAA029A
G			j. k.	Rotor shaft O-rings clean and free from surface damage Proper assembly per drawings and specifications	DAA030A ACZ150A
Н			l.	Barrier-Booster Housing for absence of corrosion prior to assembly	ACZ032A
H			m.	Barrier-Booster Rotor Assembly for absence of corrosion prior to	
				assembly	ACZ031A
Н			n.	Threaded hole damage	ACY147
D,F			0.	Diameter of rotor O-ring groove	ACZ066A
		6.	For	New Barrier-Booster Rotor, verify:	
Α			a.	Diameter of rotor O-ring groove	ACZ066
Α			b.	Width of rotor O-ring groove	ACZ186
A,D,F			C.	Surface finish of O-ring groove	ACZ073
Α			d.	Perpendicularity of rotor shaft to rotor flange	ACZ131



DATE: 05 Oct 2001
No. 10-03-02-14R/01 SUPERSEDES PAGE: 420-1ff.
DATED: 31 Jul 2000

7. For New Barrier-Booster Assembly, Loaded, verify:

		A,D,E,					
		F,G,H	(T)		a.	Barrier-Booster rotor shaft and SII seals leak tested at low pressure with rotor in "SAFE" position per engineering	ADA024
		С			b.	O-ring shelf life has not expired at time of installation	ADA024 ADA104
		С			C.	Shelf life of filtered grease, has not expired	ANO068
	562	D,F			d.	Barrier-Booster Housing and RSRM Port Plug (closure screw for	
						lock/safety wire) threads are free of nicks, scratches, or dents prior to installation	DAA027
	562	D,F,G			e.	Leak check port and RSRM Port Plug (closure screw for	DAAUZI
		, , -				lock/safety wire) are clean and free of foreign materials prior to	
	500	5.50				installation per engineering	ADA071
	562	D,F,G			f.	Installation of the O-ring onto the RSRM Port Plug (closure screw for lock/safety wire) per engineering	ADA164
	562	G			g.	RSRM Port Plug (closure screw for lock/safety wire) O-ring is	ADA 104
	002	Ü			9.	clean and free from surface damage prior to installation per	
						specification	ADA162
	562	G,H			h.	Filtered grease is applied to the RSRM Port Plug (closure screw	AD A070
	562	G			i.	for lock/safety wire) and O-ring per engineering Torque on the RSRM Port Plug (closure screw for lock/safety	ADA078
	302	O			١.	wire) is acceptable per specifications	ADA069
٠							
				8.	For	New Grease verify:	
		В	(T)		a.	Penetration	LAA037
		В	(T)		b.	Dropping point	ANO042
		B B	(T)		c. d.	Zinc concentration	LAA038 ANO050
		C			u. e.	Type Material received in closed containers	ANO030 ANO015
		Ü		•			7.110010
				9.	For	New Filtered Grease verify:	
		В	(T)		a.	Contamination	ANO064
ı	562			10	Eor	New Lock/Safety Wire verify:	
ı	302			10.	FUI	New Lock/Salety Wile Verily.	
		В			a.	Certificate of Conformance complete and acceptable	AJV000
		E			b.	Diameter	AJV005
				11.	VC	C verifies:	
				11.	NOC	o verilles.	
						Torque point on CSA DCDM Dort Dlug (alequire corour for	
	562	G			a.	Torque paint on S&A RSRM Port Plug (closure screw for	
	562	G			a.	lock/safety wire) is unbroken prior to installation of lock/safety	0145446
						lock/safety wire) is unbroken prior to installation of lock/safety wire per OMRSD File V, Vol. I, B47GEN.140	OMD118
	562 562F				a. b.	lock/safety wire) is unbroken prior to installation of lock/safety	OMD118 OMD041